# Technical Bulletin

**Model(s)**
32WLT66, 37WLT66, 42WLT66, 47WLT66
**Symptom**
Int or No Analogue Tuning,
Int or No Audio,
Timer Light Flashing,
Self check says "MSP" faulty
**Cause**
Connection problem with connector PJ22 between AV input board and Video Module.
**Cure**
Refit connector, from Signal PCB to Input PCB PJ22, See pics:

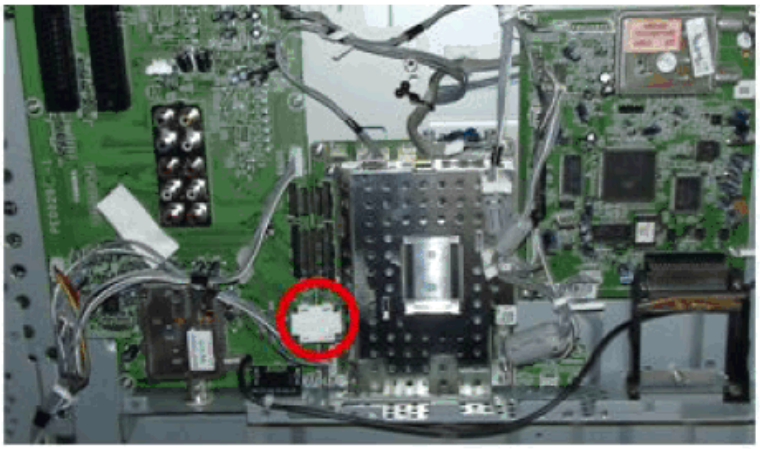

Back View of WLT66
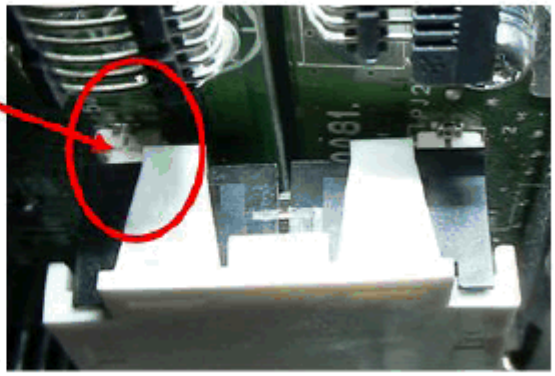
Connector not pushed fully home